



Your Accu-Drive® Technology

What is an Elite® OAP / OAD?


OAP - overrunning alternator pulley

Benefits:

- › Overrun function (will completely eliminate shutdown chirp and 1-2 shift belt chirp)
- › An internal clutch that allows the rotor of the alternator to coast
- › Will not loosen due to engine decelerations when torqued properly during installation

Technical Information:

- › No isolation function (no spring)
- › May cause 1-2 shift noise (overrun) in cabin (normal)
- › Never recommended for use on vehicles originally designed with a Litens OAD

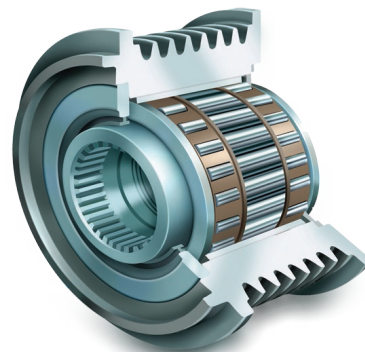


OAD - overrunning alternator decoupler

Benefits:

- › Superior vibration-absorbing ability
- › Excellent one-way clutch function
- › Proven OE durability
- › Patented technology

Technical Information:

- › Application-specific spring is tuned to vibration levels and alternator mass
- › Continental Elite® OADs create a quieter and longer-lasting accessory belt drive system

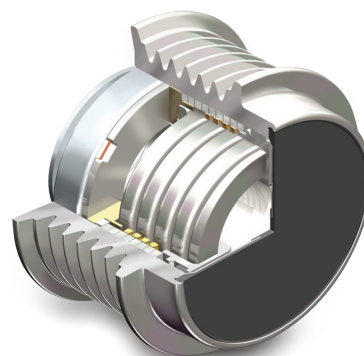

See back for OAD and OAP toolkit



Replacing an OAP/OAD

1. A special tool is required to remove and install an OAP/OAD. A complete toolkit is available from your Elite® supplier, part # 08006.
2. Remove the plastic cap. Don't reuse the cap; it's provided with the new part.
3. OAP & OAD are NOT interchangeable. Make sure you have the proper pulley for the application specified.

Expected Service Life (Should be inspected frequently.)

Most vehicle manufacturers recommend replacing your alternator pulley every:

- **20K-100K miles** (32km-160km) for severe duty applications
- **35K-120K miles** (56km-193km) for normal duty applications

See the manufacturer's recommended guidelines

Part #	Type	Year	Make
49701	OAP	1999-98	Mercedes-Benz E300D
49702	OAP	1998	Volkswagen Beetle
49703	OAP	2013-98	Audi A3, TT Quattro
49703	OAP	2013-98	Volkswagen Beetle, Eos, Golf City, Gti, Jetta, Passat
49704	OAP	2009-99	Porsche 911, Boxster, Cayman
49705	OAP	2002-95	Volkswagen Jetta, Passat
49706	OAP	2002-00	Volvo S40, V40
49707	OAP	2001-00	Mazda MPV
49708	OAP	2005-03	Mercedes-Benz C230
49709	OAP	2006-98	Volvo C70, S40, S60, S70, S80, V40, V70, XC70, Xc90
49710	OAP	2009-07	Audi Q7
49710	OAP	2006-05	Porsche Cayenne
49710	OAP	2008-04	Volkswagen Touareg
49711	OAP	2007-98	Dodge Ram 2500 & 3500 Pickup
49711	OAP	2009-08	Porsche Boxster, Cayman
49712	OAP	2006-04	Ford Expedition
49712	OAP	2006-05	Lincoln Navigator
49713	OAP	2008-02	Jaguar X-Type
49714	OAP	2011-02	Nissan Altima, Frontier, Sentra
49715	OAP	2003	Dodge Sprinter 2500, Sprinter 3500
49716	OAP	2006	Ford Focus
49716	OAP	2010-09	Suzuki Equator
49717	OAP	2006-05	Ford Focus
49718	OAP	2010-05	Buick Allure, Lacrosse
49719	OAP	2007-05	Ford Escape, Focus
49719	OAP	2006	Mazda Tribute
49720	OAP	2007	Dodge Sprinter 2500, Sprinter 3500
49720	OAP	2009-07	Jeep Grand Cherokee
49721	OAP	2010-08	Mitsubishi Lancer, Outlander
49722	OAP	2011-06	BMW 128i, 135i, 328i Xdrive, 328Xi, 330i, 528i Xdrive, 528Xi, X3, X5, Z4
49908	OAD	2004-97	Chevrolet Corvette
49911	OAD	2007-01	Chrysler Pacifica, Town & Country, Voyager
49911	OAD	2007-01	Dodge Caravan, Grand Caravan
49911	OAD	2010-09	Pontiac Vibe
49911	OAD	2013-08	Scion xD
49911	OAD	2013-98	Toyota Celica, Corolla, Matrix
49912	OAD	2010-05	Chevrolet Cobalt, Hhr
49912	OAD	2007-04	Saturn Ion
49914	OAD	2010-09	Pontiac Vibe
49914	OAD	2012-08	Scion xB
49914	OAD	2013-06	Toyota Camry, Corolla, Matrix, RAV-4, Solara
49915	OAD	2013-07	Chrysler 200, Sebring

Part #	Type	Year	Make
49915	OAD	2013-07	Dodge Avenger, Caliber
49915	OAD	2013-07	Jeep Compass, Patriot
49916	OAD	2014-06	Lexus ES350, GS300, GS350, IS250, IS350, RX350, RX450H
49916	OAD	2013-05	Toyota 4-Runner, Avalon, Camry, FJ Cruiser, Highlander, RAV-4, Sienna, Tundra, Venza
49917	OAD	2011-03	Saab 9-3
49918	OAD	2006-05	Jeep Liberty
49919	OAD	2008-05	Chrysler Pacifica
49920	OAD	2012-01	John Deere 5620 Ag Tractor, 5720 Ag Tractor, 5820 Ag Tractor, 6010 Ag Tractor, 6020 Ag Tractor, 6110 Ag Tractor
49921	OAD	2011-09	Buick Lucerne
49921	OAD	2013-08	Cadillac CTS
49923	OAD	2009-08	Land Rover LR2
49924	OAD	2013-07	Toyota Tacoma
49925	OAD	2009-05	Chevrolet Corvette
49926	OAD	2009-07	Pontiac Solstice
49926	OAD	2010-07	Saturn Sky
49927	OAD	2002-01	Chrysler Prowler
49927	OAD	2001-99	Plymouth Prowler
49927	OAD	2006-05	Pontiac GTO
49928	OAD	2011-06	Chevrolet Impala, Malibu
49928	OAD	2009-07	Pontiac G6
49929	OAD	2006	Pontiac G6
49930	OAD	2011-10	Toyota Camry
49931	OAD	2011-09	Toyota RAV-4
49932	OAD	2012-09	Toyota Highlander, Venza
49933	OAD	2007	Chevrolet Impala
49934	OAD	2013-09	Audi A4 Quattro, A5 Quattro, A6 Quattro, Q5, S4, S5v
49935	OAD	2011-03	Ford Crown Victoria
49935	OAD	2010-00	Mercury Grand Marquis
49936	OAD	2011	Honda Accord Crosstour, Odyssey
49937	OAD	2011	Dodge Challenger, Charger, Durango, Journey
49937	OAD	2011	Jeep Grand Cherokee
49938	OAD	2012-10	Chevrolet Camaro
49939	OAD	2012-10	Chevrolet Camaro
49940	OAD	2012-11	Hyundai Elantra
49941	OAD	2013-11	Chrysler 200, Town & Country
49941	OAD	2013-11	Dodge Grand Caravan, Journey
49941	OAD	2013-12	Ram C/V
49942	OAD	2013-11	Hyundai Elantra, Veloster
49942	OAD	2012-11	Kia Rio, Soul



Legal Notice

The content of this publication is not legally binding and is provided as information only. The trademarks displayed in this publication are the property of Continental AG and/or its affiliates. Copyright © 2014 ContiTech AG. All rights reserved.

Contact

ContiTech North America
Veyance Technologies, Inc.
703 S. Cleveland Massillon Road
Fairlawn, OH 44333-3023 U.S.A.

U.S.A. and Canada

1-800-869-0435
FAX 1-800-228-3148

Canada

(French only)
1-888-275-4397
FAX 1-888-464-4397

Mexico

(Within Mexico)
01-800-439-7373

(Outside Mexico)
+52-444-834-5803



20786760

continental-elite.com